

# City of Baltimore Wet Weather Consent Decree Smoke and Dyed Water Testing Form

Page 1 of 1

Sewershed: Gwynns Falls

Company: Savin

Date: 4/28/2009

Test to be performed:

Smoke ☐ Dyed Water ☒

Ground Condition:

Dry ☒ Damp ☐ Wet ☐

Supervisor: JAW


Manhole\_ID: S03UU\_013MH

Test ID: D1032-022012

Notification Made: NA

(Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

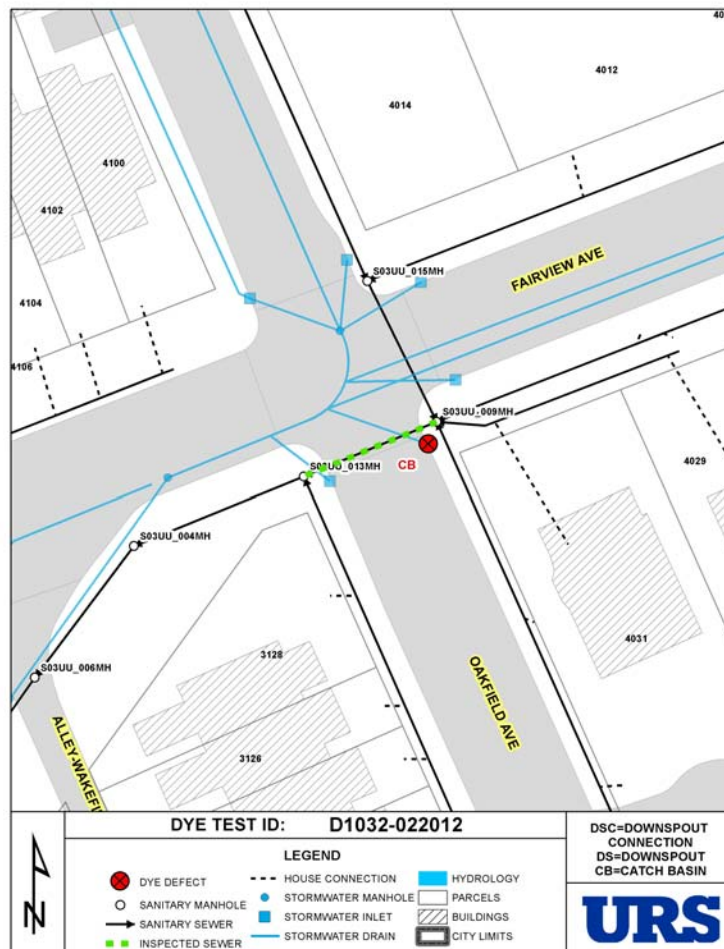

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks
0			Start of Survey	
0			Manhole	S03UU_009MH
0			Water Level	
2			Dye Test Visible	MH WALLS
4			Joint Offset Large	IN OAKFIELD LINE
4			Dye Test Visible	AT JOL
4	12	04	Hole Void Visible	AT DROP IN OAKFIELD LINE
5.099999905	12	12	Broken Void Visible	IN OAKFIELD LINE
5.099999905			Dye Test Visible	FROM BROKEN PIPE ON OAKFIELD LIN
10			Abandoned Survey	LINED PIPE, NO MORE LEAKS SEEN